

CONCISE COMMUNICATION

Copper Continuously Limits the Concentration of Bacteria Resident on Bed Rails within the Intensive Care Unit

Michael G. Schmidt, PhD;¹ Hubert H. Attaway III, MS;¹
Sarah E. Fairey, BS;¹ Lisa L. Steed, PhD;²
Harold T. Michels, PhD;³ Cassandra D. Salgado, MD, MS⁴

Cleaning is an effective way to lower the bacterial burden (BB) on surfaces and minimize the infection risk to patients. However, BB can quickly return. Copper, when used to surface hospital bed rails, was found to consistently limit surface BB before and after cleaning through its continuous antimicrobial activity.

Infect Control Hosp Epidemiol 2013;34(5):530-533

Microbes have an intrinsic ability to survive and colonize commonly touched surfaces in hospitals. To prevent health-care-associated infections (HAIs), infection control (IC) guidelines recommend that, in concert with hand hygiene, attention be paid to disinfection of patient-care surfaces, especially those designated high-touch objects (HTOs).¹ Such objects could contribute to transmission by contaminating the hands of healthcare workers (HCWs) who subsequently contact patients.² Routine and terminal cleaning of surfaces and objects within the room using a hospital-grade disinfectant has been an accepted method for controlling and limiting the spread of infectious agents.¹ A concentration of less than 250 aerobic colony-forming units (cfu) of bacteria per 100 cm² has been proposed as a benchmark where infectious risk to patients is low.³

In 2008, the United States Environmental Protection Agency (US-EPA) registered 5 families of copper-containing alloys as antimicrobial, which established that products manufactured from these alloys kill 99.9% (log₁₀ 2.0) of bacteria within 2 hours of exposure.⁴ Subsequently, copper has been used to limit bacterial burden (BB) found on commonly touched surfaces and objects in healthcare. Casey et al⁵ observed a median microbial reduction between 90% and 100% (log₁₀ 1.95 to log₁₀ 2.0) on copper-surfaced push plates, faucet handles, and toilet seats, whereas Schmidt et al⁶ demonstrated an 83% (log₁₀ 1.93) reduction in BB for copper-surfaced objects over the course of a 43-month multicenter trial.

Cleaning can effectively remove pathogens from surfaces, but studies have shown that, more than half of the time, surfaces were not adequately terminally cleaned and may become recontaminated within minutes.^{7,8} The rails of hospital beds, as a consequence of coincident interactions with pa-

tients, HCWs, and visitors, are one of the most frequently touched items in the patient care environment. In this study, we quantitatively assessed the BB present on bed rails to evaluate the effectiveness of the antimicrobial properties of metallic copper to continuously limit the concentration of bacteria resident before and after routine cleaning.

MATERIAL AND METHODS

This institutional review board–approved study was conducted within a 17-bed medical intensive care unit (MICU) of a 660-bed academic hospital. In accordance with hospital policy, visitors were permitted between 8 AM and 8 PM at the discretion of staff. Each single-patient room contained an In Touch Critical Care Bed (Stryker). Routine patient care was provided throughout the course of the study, including teaching rounds, resulting in numerous patient visits with direct contact between the healthcare team, patients, and built environment.

Standard In Touch beds have 4 plastic rails. Three beds were custom fitted with copper (UNS# C110 99.9% metallic copper) surface caps on the rails as described elsewhere by Schmidt et al.⁶

In accordance with MICU policy, all objects and surfaces within the patient's room, including the study bed rails, were cleaned at least daily and upon patient discharge from the hospital (ie, terminally cleaned) using the US-EPA–registered disinfectant Virex II 256, which was dispensed from an automated dilution system (Use Solution, 0.07% n-alkyl dimethyl benzyl ammonium chloride and 0.07% didecyl dimethyl ammonium chloride; Johnson Diversey) as prescribed by the manufacturer.

Bed rail sampling was conducted in candidate rooms if the patient housed there would be continuously occupying the room for the next 8 hours and if sampling at 2-hour intervals would not affect care. Cleaning staff were not made aware of the study. Plastic (control) and copper bed rails were sampled immediately before cleaning (time 0) and then at 30 minutes and 2.5, 4.5, and 6.5 hours after cleaning. Samples were taken on 5 separate occasions over a 3-month period. Three patient-occupied beds with plastic rails (controls) and 3 with copper rails were sampled on each occasion, resulting in evaluation of 30 beds. Samples were collected and processed as described elsewhere.^{6,8}

The effectiveness with which copper reduced resident BB was calculated by measuring the difference between the BB on copper bed rails and that on plastic bed rails. A mean reduction in BB was calculated for each type of bed rail and compared using the Mann-Whitney and Wilcoxon rank test (Epi Info, version 3.5.1). In a previous study, copper surfaces were associated with an 83% (log₁₀ 1.92) reduction in BB, compared with plastic surfaces.⁶ Based on this, we calculated

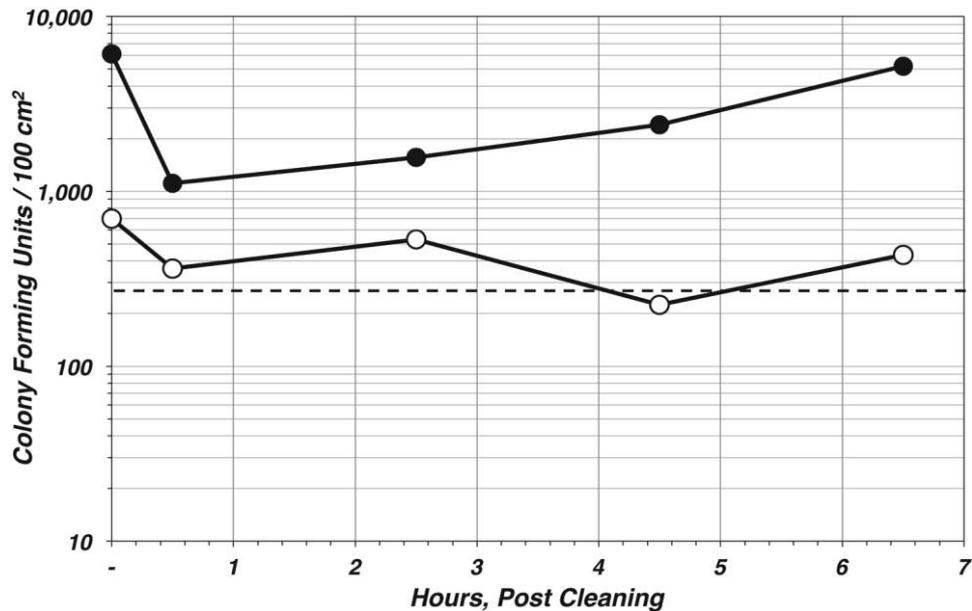


FIGURE 1. Copper continuously limits the concentration of bacteria on bed rails. Shown are the average total aerobic colony-forming units per 100 cm² recovered from standard plastic bed rails (filled circles) and copper bed rails (open circles) before and after cleaning with Virex 256. Five independent replicates are shown, and 3 beds of each type were sampled per time period. Dashed line represents the suggested bacterial burden desired immediately after terminal cleaning (250 colony-forming units per 100 cm²).

that a sample size of 7 beds per group was necessary to have at least 90% power to detect an absolute BB decrease of 83% between copper-surfaced bed rails and standard plastic bed rails at a 5% significance level.

RESULTS

Average length of stay was 7.3 days for patients cared for in the plastic-railed beds and 8.6 days for patients cared for in the copper-railed beds. Compared with the mean BB found on plastic rails, the mean found immediately before cleaning on copper rails was significantly lower (6,102 cfu per 100 cm² or log₁₀ 3.79 per 100 cm² vs 698 cfu per 100 cm² or log₁₀ 2.84 per 100 cm²; Figure 1). Subsequent cleaning of bed rails resulted in an immediate decrease in BB regardless of the bed rail surface. The mean reduction was 82% (1,112 cfu per 100 cm² or log₁₀ 3.05 per 100 cm²) on plastic rails and 48% (362

cfu per 100 cm² or log₁₀ 2.56 per 100 cm²) on copper rails. Continued sampling subsequent to cleaning found that the mean BB on copper rails remained significantly lower than that on plastic rails (Table 1). Among the beds with unmodified plastic rails, the highest initial BB recorded at any time over the study period was 32,400 cfu per 100 cm² (log₁₀ 4.51 per 100 cm²), whereas the lowest was undetectable for 5 (6.6%) of the 75 plastic-railed beds. Among copper beds, the highest initial BB was 5,310 cfu per 100 cm² (log₁₀ 2.56 per 100 cm²), whereas the lowest was undetectable for 37 (49.3%) of 75 copper-railed beds sampled.

In assessing the frequency with which the BB on the surfaces of bed rails was below a proposed value that was suggested as low risk immediately after terminal cleaning, 250 cfu per 100 cm², it was found that the difference observed between the copper-surfaced and plastic-surfaced rails was

TABLE 1. Assessment of the Antimicrobial Activity of Copper to Control the Bacterial Burden between Cleanings with Virex 256

Time point	Plastic bed rails		Copper bed rails		P
	Colony count, mean cfu/100 cm ² (±SE)	Reduction, %	Colony count, mean cfu/100 cm ² (±SE)	Reduction, %	
Precleaning	6,102 ± 2,572		698 ± 368		.006
Hour 0.5	1,112 ± 802	82	362 ± 282	48	.069
Hour 2.5	1,560 ± 936	74	530 ± 530	24	.012
Hour 4.5	2,396 ± 1,502	61	224 ± 94	68	.013
Hour 6.5	5,198 ± 2,386	15	434 ± 236	38	.002

NOTE. SE, standard error.

TABLE 2. Frequency Bacterial Burden Was Below Suggested Terminal Cleaning Standard Immediately before and after Routine Cleaning Conducted during Routine Patient Care

Time point	Bed rails with colony count <250 cfu/100 cm ²				P (2-tailed)
	Plastic rails associated with 15 beds	Bed rail colony count <250 cfu/100 cm ² , %	Copper rails associated with 15 beds	Bed rail colony count <250 cfu/100 cm ² , %	
Precleaning	4	27	10	67	.067
Hour 0.5	10	67	13	87	.86
Hour 2.5	7	47	12	80	.13
Hour 4.5	8	53	11	73	.44
Hour 6.5	5	33	12	80	.02
Overall	34/75	45	58/75	77	.0001

NOTE. cfu, colony-forming units.

significant ($P = .0001$). A total of 77% of copper-surfaced rails were below this level, whereas only 45% of plastic rails were below this critical threshold (Table 2).

DISCUSSION

The patient room is a kinetic reservoir where hard surfaces, equipment, furniture, and the belongings of patients serve as fomites where casual touch may transfer resident microbes to patients and HCWs. Here, we report the quantitative effectiveness with which copper surfaces were able to augment routine cleaning practices to continuously limit the BB resident on the rails of patient beds.

Bacteria responsible for many HAIs can survive for days, weeks, or months on hospital surfaces in spite of the best efforts of the healthcare team to keep the BB within limits considered safe for patient care.³ Some have argued that terminal cleaning must achieve a threshold where fewer than 250 cfu per 100 cm² of aerobic bacteria are detectable to minimize risk of transfer to HCWs or patients.⁹ In previous work, we described the rapid reestablishment of bacteria on bed rail surfaces after cleaning with a hospital-grade disinfectant.⁸ These data suggested that, to keep the BB below the risk-based threshold, surfaces would require cleaning at enhanced intervals and that this would result in increased workload for HCWs and environmental services. The current study would suggest that this cleaning interval would need to commence between every 2.5 and 4.5 hours for beds with standard plastic rails. However, in concert with once-daily cleaning, copper bed rails were routinely able to maintain a BB below a low-risk threshold for the entire shift. Low-risk concentrations were associated with 77% of the sampled copper beds.

The use of copper to control BB on surfaces found in healthcare has been recently reviewed.¹⁰ Here, we demonstrate that the antimicrobial activity was continuous in its ability to limit BB found on bed rails. Weber and Rutala,¹¹ in their commentary of work conducted by Karpanen et al,¹² argued that it was impractical or impossible to coat each environmental surface with copper. However, the data provided here and in other studies suggest that the strategic placement of copper in key high-touch areas offers a novel strategy to limit

BB on a continuous basis.⁶ Other no-touch methods for room disinfection (hydrogen peroxide vapor [HPV] and UV light) rely on discontinuous modalities of application to reduce environmental BB.¹³ Consequently, like the US-EPA-registered disinfectants that are regularly used to disinfect patient rooms subsequent to cleaning, both UV and HPV will likely have the same limitation of rapid restoration of BB intrinsic to HTOs. In contrast, copper-alloyed surfaces offer a continuous way to limit and/or control the environmental burden. Hospital and environmental services need not perform additional steps, follow complex treatment algorithms, obtain “buy-in” from other providers, or require additional training or oversight.

It is intuitive to argue that, to minimize infectious risk to a patient, any method that augments the effectiveness of hand hygiene and routine cleaning will likely translate into lower rates of HAIs and/or hospital-acquired colonizations with epidemiologically important pathogens. The continuous antimicrobial activity of copper surfaces demonstrated here should enhance routine and terminal-cleaning practices required of hospitals.

ACKNOWLEDGMENTS

We acknowledge the assistance of Janet Byrne and the staff of the MUSC MICU as well as Chuck Stark, Dennis Simon, and Kathy Zolman of Advanced Technologies Institute; Adam Estelle, Wilton Moran, and Jim Michel of the Copper Development Association; and Peter Sharpe of Sharpe and Associates for assistance with developing the copper alloyed bed rails.

Financial support. Supported by the US Army Materiel Command Contract W81XWH-07-C-0053. The views, opinions and/or findings presented here are those of the authors and should not be construed as an official US Department of the Army position.

Potential conflicts of interest. H.T.M. is senior vice president for research and development for the Copper Development Association and was the principal investigator of the funds awarded to support the study. He provided expertise for antimicrobial alloy specifications. Similar to other authors, he received salary support and funds to purchase supplies and materials. None of the other authors received funds from the Copper Development Association for the conduct of this research. The Copper Development Association did not provide any funds for the conduct of this research. In full disclosure, the employer of H.T.M. promotes the active use of copper for industrial applications. All other authors report no conflicts of interest relevant to this

article. All authors submitted the ICMJE Form for Disclosure of Potential Conflicts of Interest, and the conflicts that the editors consider relevant to this article are disclosed here.

Affiliations: 1. Department of Microbiology and Immunology, Medical University of South Carolina, Charleston, South Carolina; 2. Department of Pathology and Laboratory Medicine, Medical University of South Carolina, Charleston, South Carolina; 3. Copper Development Association, New York, New York; 4. Division of Infectious Diseases, Department of Medicine, Medical University of South Carolina, Charleston, South Carolina.

Address correspondence to Michael G. Schmidt, PhD, Medical University of South Carolina, Department of Microbiology and Immunology, 173 Ashley Avenue, BSB 319G, Charleston, SC 29425 (schmidt@musc.edu).

Received June 3, 2012; accepted August 26, 2012; electronically published April 9, 2013.

© 2013 by The Society for Healthcare Epidemiology of America. All rights reserved. 0899-823X/2012/3405-0016\$15.00. DOI: 10.1086/670224

REFERENCES

- Rutala WA, Weber DJ; Healthcare Infection Control Practices Advisory Committee (HICPAC). Guideline for disinfection and sterilization in healthcare facilities, 2008. http://www.cdc.gov/hicpac/pdf/Disinfection_Sterilization/Pages1_2Disinfection_Nov_2008.pdf.
- Boyce JM. Environmental contamination makes an important contribution to hospital infection. *J Hosp Infect.* 2007;65(suppl 2):50–54.
- Mulvey D, Redding P, Robertson C, et al. Finding a benchmark for monitoring hospital cleanliness. *J Hosp Infect* 2011;77(1):25–30.
- United States Environmental Protection Agency. EPA registers copper-containing alloy products. <http://www.epa.gov/opp00001/factsheets/copper-alloy-products.htm>. 2008.
- Casey AL, Adams D, Karpanen TJ, et al. Role of copper in reducing hospital environment contamination. *J Hosp Infect* 2010;74(1):72–77.
- Schmidt MG, Attaway HH, Sharpe PA, et al. Sustained reduction of microbial burden on common hospital surfaces through introduction of copper. *J Clin Microbiol* 2012;50(7):2217–2223.
- Carling PC, Bartley JM. Evaluating hygienic cleaning in health care settings: what you do not know can harm your patients. *Am J Infect Control* 2010;38(5 suppl 1):S41–50.
- Attaway HH 3rd, Fairey S, Steed LL, Salgado CD, Michels HT, Schmidt MG. Intrinsic bacterial burden associated with intensive care unit hospital beds: effects of disinfection on population recovery and mitigation of potential infection risk. *Am J Infect Control* 2012;40:907–912.
- White LF, Dancer SJ, Robertson C, McDonald J. Are hygiene standards useful in assessing infection risk? *Am J Infect Control* 2008;36(5):381–384.
- O’Gorman J, Humphreys H. Application of copper to prevent and control infection. Where are we now? *J Hosp Infect* 2012; 81(4):217–223.
- Weber DJ, Rutala WA. Self-disinfecting surfaces. *Infect Control Hosp Epidemiol* 2012;33(1):10–13.
- Karpanen TJ, Casey AL, Lambert PA, et al. The antimicrobial efficacy of copper alloy furnishing in the clinical environment: a crossover study. *Infect Control Hosp Epidemiol* 2012;33(1):3–9.
- Havill NL, Moore BA, Boyce JM. Comparison of the microbiological efficacy of hydrogen peroxide vapor and ultraviolet light processes for room decontamination. *Infect Control Hosp Epidemiol* 2012;33(5):507–512.